# **HOME REPORT**

FLAT

1A GROUND FLOOR RIGHT THE GLEBE

MAIN STREET, ST NINIANS

STIRLING

FK7 9AN





# ENERGY PERFORMANCE CERTIFICATE



# **Energy Performance Certificate (EPC)**

**Dwellings** 

# **Scotland**

# FLAT 1A GROUND FLOOR RIGHT THE GLEBE, MAIN STREET, ST NINIANS, STIRLING, FK7 9AN

Dwelling type:Ground-floor flatDate of assessment:22 March 2024Date of certificate:25 March 2024

Total floor area: 57 m<sup>2</sup>

Primary Energy Indicator: 333 kWh/m²/year

Reference number: 0160-2912-8170-2924-1765
Type of assessment: RdSAP, existing dwelling

Approved Organisation: Elmhurst

Main heating and fuel: Boiler and radiators, mains


gas

### You can use this document to:

- . Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

Estimated energy costs for your home for 3 years*	£4,020	See your recommendations
Over 3 years you could save*	£1,905	report for more information

<sup>\*</sup> based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

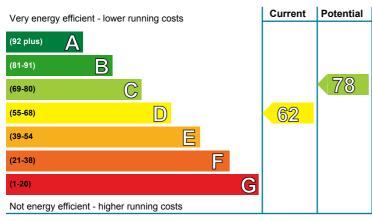


# **Energy Efficiency Rating**

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (62)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

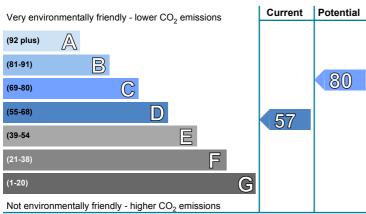

# **Environmental Impact (CO<sub>2</sub>) Rating**

This graph shows the effect of your home on the environment in terms of carbon dioxide  $(CO_2)$  emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (57)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

# Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal or external wall insulation	£4,000 - £14,000	£603.00
2 Floor insulation (suspended floor)	£800 - £1,200	£321.00
3 Add additional 80 mm jacket to hot water cylinder	£15 - £30	£90.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

# Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	****	****
Roof	(another dwelling above)	_	_
Floor	Suspended, no insulation (assumed)	_	_
Windows	Fully double glazed	***	***
Main heating	Boiler and radiators, mains gas	****	<b>★★★★</b> ☆
Main heating controls	Programmer, TRVs and bypass	***	***
Secondary heating	None	_	_
Hot water	From main system, no cylinder thermostat	***	***
Lighting	Low energy lighting in all fixed outlets	****	****

# The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

# The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 59 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 3.4 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 1.9 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

# Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£2,430 over 3 years	£1,278 over 3 years	
Hot water	£1,341 over 3 years	£588 over 3 years	You could
Lighting	£249 over 3 years	£249 over 3 years	save £1,905
Tota	ls £4,020	£2,115	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

# Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.


December and ad management		Indicative cost	Typical saving	Rating after improvement	
Re	commended measures	indicative cost	per year	Energy	Environment
1	Internal or external wall insulation	£4,000 - £14,000	£201	D 67	D 65
2	Floor insulation (suspended floor)	£800 - £1,200	£107	C 70	D 68
3	Add additional 80 mm jacket to hot water cylinder	£15 - £30	£30	C 70	C 70
4	Hot water cylinder thermostat	£200 - £400	£53	C 72	C 72
5	Upgrade heating controls	£350 - £450	£68	C 74	C 74
6	Replace boiler with new condensing boiler	£2,200 - £3,000	£176	C 78	C 80

### **Alternative measures**

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Air or ground source heat pump
- Micro CHP

# Choosing the right improvement package





# About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

## 2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

### 3 Hot water cylinder insulation

Increasing the thickness of existing insulation by adding an 80 mm cylinder jacket around the hot water cylinder will help maintain the water at the required temperature; this will reduce the amount of energy used and lower fuel bills. The jacket should be fitted over the top of the existing foam insulation and over any thermostat clamped to the cylinder. Hot water pipes from the hot water cylinder should also be insulated, using pre-formed pipe insulation of up to 50 mm thickness, or to suit the space available, for as far as they can be accessed to reduce losses in summer. All these materials can be purchased from DIY stores and installed by a competent DIY enthusiast.

### 4 Cylinder thermostat

A hot water cylinder thermostat enables the boiler to switch off when the water in the cylinder reaches the required temperature; this minimises the amount of energy that is used and lowers fuel bills. The thermostat is a temperature sensor that sends a signal to the boiler when the required temperature is reached. To be fully effective it needs to be sited in the correct position and hard wired in place, so it should be installed by a competent plumber or heating engineer. Building regulations apply to this work, so it is best to check with your local authority building standards department whether a building warrant will be required.

# 5 Heating controls (room thermostat)

The heating system should have a room thermostat to enable the boiler to switch off when no heat is required. A competent heating engineer should be asked to do this work. Insist that the thermostat switches off the boiler as well as the pump and that the thermostatic radiator valve is removed from any radiator in the same room as the thermostat. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

# 6 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

# Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

# Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	5,263	N/A	N/A	(1,655)
Water heating (kWh per year)	3,261			

# **Addendum**

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

# **About this document**

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Gordon McCulloch

Assessor membership number: EES/009378

Company name/trading name: D M Hall Chartered Surveyors LLP

Address: Suite 2C 1 Pitt Terrace

Stirling FK8 2EZ

Phone number: 01786 475785

Email address: gordon.mcculloch@dmhall.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

# Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



# SINGLE SURVEY



# survey report on:

Property address	FLAT, 1A GROUND FLOOR RIGHT THE GLEBE, MAIN STREET, ST NINIANS, STIRLING, FK7 9AN
Customer	Mr Gordon Wilson
Customer address	
Prepared by	DM Hall LLP
Date of inspection	22nd March 2024



# **PART 1 - GENERAL**

### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

Х

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

<sup>&</sup>lt;sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

### 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether
  or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

## 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

# 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.<sup>2</sup>

### 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

<sup>&</sup>lt;sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

they assign the same to any other party in writing.

## 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

### 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

# 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

# 1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller:
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

# PART 2 - DESCRIPTION OF THE REPORT

# 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

# 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

## 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

## 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

# 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein

the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

# 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a GROUND FLOOR FLAT within a two-storey building.
Accommodation	On Ground Floor: Hallway, Lounge, Kitchen, One Bedroom and Bathoom.
Gross internal floor area (m²)	57
Neighbourhood and location	The property is contained within a principally residential area on one of the main thoroughfares leading towards the town centre of Stirling. A local parade of shops, etc are also located close by. Local amenities are generally all close at hand.
Age	150 years approximately.
Weather	The weather was dry but cloudy following mixed weather over the past fortnight.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate.
	The chimney stacks serving the building are of traditional pointed sandstone construction and also pointed brickwork, with flashings formed in lead or similar material.
Roofing including roof space	Claning roofs were visually inspected with the sid of
Rooming including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.
	Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.
	Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.
	If this is not possible, then physical access to the roof space

Roofing including roof space	may be taken by other means if the Surveyor deems it safe and reasonable to do so.
	The roof is of pitched design and clad externally in slate.
	No access gained to the common roof void. The hatch was padlocked shut on the date of inspection.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	The gutters, downpipes and external plumbing are a mix of cast iron and PVC materials.
Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The main external walls are of traditional solid stone construction with a pointed outer finish. The rear stairwell projection is of rendered brick.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	The windows are of aluminium framed and double glazed design, the front entrance door is of UPVC materials and there is a timber back door to the stairwell / close. Facias etc are of timber materials.
External decorations	Visually inspected.
	Painted finishes have been applied to external joinery and cast rainwater fittings in the past.
Conservatories / porches	None.
Communal areas	Circulation areas visually inspected.
	The main external building fabric is presumed to be a communal responsibility and will include items such as roof claddings, rainwater fittings, external masonry and the chimney stacks. There is a common close and stairwell leading to other flats within the building, communal areas of drying green, etc., and a dilapidated outbuilding to the rear. The exact extent of any private and communal areas can all be verified by reference to Title Deed documentation.

Garages and permanent outbuildings	Visually inspected.  There is a dilapidated outbuilding to the rear. There are two store
	cupboards within the common close/stairwell area which appear to pertain to the subjects, although this point should be confirmed.  One of these cupboards contains the central heating boiler and hot water cylinder.
Outside areas and boundaries	There are areas of ground at the front and rear which are presumed to be communal in nature although this point can be confirmed by reference to Title Deed documentation. The boundaries are formed with a mixture of stone walls, etc
Ceilings	Visually inspected from floor level.
	The ceilings within the property appear to be a mix of lath and plaster and plasterboard materials. Some Artex/textured finishes are present.
Internal walls	Visually inspected from floor level.
micrial walls	
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	The internal walls are also a combination of plaster on the hard, lath and plaster and plasterboard finishes.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.
	Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.
	The flooring is of suspended timber construction throughout. Fitted floor coverings were present and there was no access to any subfloor areas.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	Internal skirtings, facings, etc are of timber materials whilst the internal doors are a mix of timber panel design or timber and glazed. There is a range of fitted floor and wall mounted units within the kitchen.

Chimney breasts and fireplaces	None - removed.
Internal decorations	Visually inspected.
	Papered/painted finishes have been applied in the main.
	rapered/painted linishes have been applied in the main.
Cellars	None.
Condition	None.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Mains supply.
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Mains supply.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	Mains supply. Visible pipework is in copper and PVC materials, although given the age of the building, I cannot discount the possibility that there could be lead plumbing within hidden and inaccessible parts of the building.
	The internal sanitaryware comprises a wc, wash-hand basin and bath with electric shower unit fitted over.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.
	No tests whatsoever were carried out to the system or appliances.
	There is a gas fired boiler within an external store within the store, which serves a range of radiators throughout the accommodation and also provides domestic hot water. The store cupboard also contains the hot water cylinder.

# Drainage Covers etc were not lifted. Neither drains nor drainage systems were tested. Drainage is connected to the main public sewer.

# Fire, smoke and burglar alarms

Visually inspected.

No tests whatsoever were carried out to the system or appliances.

Smoke alarms are installed.

Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.

# Any additional limits to inspection

### For flats / maisonettes

Only the subject flat and internal communal areas giving access to the flat were inspected.

If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.

The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.

Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.

I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.

The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor. Any such materials should not be drilled or disturbed without prior advice from a licensed specialist.

Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

The property was unoccupied but all floors were covered. Floor coverings restricted my inspection.

In accordance with Health and Safety guidelines I have not disturbed insulation, furniture or personal effects (particularly in

# Any additional limits to inspection

cupboards). Floor coverings have not been moved.


My inspection of the roof covering was restricted from ground level and some parts were not visible.

Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.

The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.

Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

# Sectional Diagram showing elements of a typical house

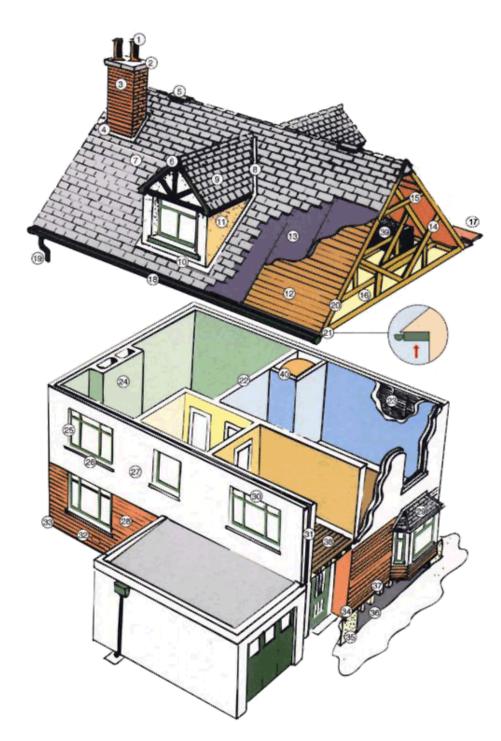

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2) Coping stone
- 3) Chimney head
- 4 Flashing
- 5 Ridge ventilation
- 6) Ridge board
- 7) Slates / tiles
- 8 Valley guttering
- Dormer projection
- 10 Dormer flashing
- 11) Dormer cheeks
- (12) Sarking
- (13) Roof felt
- (14) Trusses
- (15) Collar
- 16 Insulation
- 17) Parapet gutter
- (18) Eaves guttering
- 19) Rainwater downpipe
- 20) Verge boards/skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- 24) Chimney breast
- (25) Window pointing
- 6) Window sills
- 27) Rendering
- (28) Brickwork / pointing
- 29) Bay window projection
- 30 Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- 33 Damp proof course
- 34) Base course
- (35) Foundations
- 36) Solum
- 37) Floor joists
- 38) Floorboards
- (39) Water tank
- 40) Hot water tank

# 2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category	1
Notes	The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

Dampness, rot and infestation	
Repair category	2
Notes	Some low level dampness readings were recorded within the property which, by themselves, are not unusual in a ground level flat of this type and age. Some levels of condensation may also be present. The levels of moisture within the property may well be reduced with a better balance of heating and ventilation. If found to be worsening or continuing, then advice will be required from a damp treatment specialist contractor.

Chimney stacks	
Repair category	2
Notes	Usual evidence of weathering and erosion was noted to chimney masonry and there will inevitably be a requirement for ongoing pointing and masonry attention.

Roofing including roof space	
Repair category	2
Notes	A number of slipped and missing slates were noted on the roof. Re-fixing and renewal of roof slates will satisfy immediate repair work, however the roof is of original materials. It may be more cost effective to initiate more extensive works such as re-roofing in the short to medium term. A reputable roofing contractor can provide further advice. Inspection at close quarters may reveal further deterioration/damage to roofing materials, especially where these are original.  No access gained to any roof space areas.

Rainwater fittings	
Repair category	2
Notes	Ongoing maintenance and repairs will be required to the rainwater fittings.

Main walls	
Repair category	2
Notes	An ongoing programme of maintenance will be required to the external masonry. Fallen / damaged render noted to the rear stairwell projection.

Windows, external doors and joinery	
Repair category	2
Notes	Weathering has occurred to timber elements of external fascia/soffit joinery. The windows are of an older replacement type which will require ongoing maintenance attention to ironmongery, hinge mechanisms, etc., and sealed double glazed units can fail without warning. Some replacements should be budgeted for however a joinery or glazing contractor will be able to provide more appropriate advice and estimates.

External decorations	
Repair category	2
Notes	Regular repainting works will be required to maintain an attractive appearance and prevent deterioration of external joinery.

Conservatories/porches	
Repair category	-
Notes	None.

Communal areas	
Repair category	2
Notes	An ongoing programme of repair and maintenance work will be required to the common building fabric, particularly roof claddings, rainwater fittings and external masonry. Areas of render damage noted to the common close/stairwell area, the rear stairwell window is in a fairly weathered state and in general, joinery around common areas will require repair attention.

Garages and permanent outbuildings	
Repair category	2
Notes	Dampness noted within the store cupboards. The rear outbuilding is also in poor condition.

Outside areas and boundaries	
Repair category	2
Notes	Ongoing maintenance will be required to boundary walls etc. around the site

Ceilings	
Repair category	2
Notes	Artex / textured finishes do sometimes contain asbestos and as such, specialist advice must be sought prior to such material being disturbed in any way.

Internal walls	
Repair category	1
Notes	No significant defects evident although some repairs may prove necessary during any redecoration.

Floors including sub-floors	
Repair category	2
Notes	Areas of flooring were noted to run off-level, indicative of past settlement of the building.
	It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.

Internal joinery and kitchen fittings	
Repair category	1
Notes	The area of kitchen fitment is always a matter of personal taste.

Chimney breasts and fireplaces	
Repair category	-
Notes	None.

Internal decorations	
Repair category	1
Notes	Internal décor is always a matter for personal taste.

Cellars	
Repair category	-
Notes	None.

Electricity	
Repair category	1
Notes	It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.

Gas	
Repair category	1
Notes	Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.

Water, plumbing and bathroom fittings	
Repair category	1
Notes	No significant defects evident, although the area of internal sanitaryware is always a matter for personal taste.

Heating and hot water	
Repair category	3
Notes	The central heating boiler is a particularly dated model, (and part of a cover is missing) and is likely at or near the end of its serviceable lifespan. A gas safe registered heating engineer will be able to provide advice and estimates for all upgrading/renewals required.
	Boilers and central heating systems should be tested and serviced by a Gas Safe registered engineer on an annual basis to ensure their safe and efficient operation.

Drainage	
Repair category	1
Notes	No significant defects evident.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	2
External decorations	2
Conservatories/porches	-
Communal areas	2
Garages and permanent outbuildings	2
Outside areas and boundaries	2
Ceilings	2
Internal walls	1
Floors including sub-floors	2
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	-
Internal decorations	1
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	3
Drainage	1

# **Category 3**

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

# Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

# Category 1

No immediate action or repair is needed.

## Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

# 3. Accessibility information

# Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground floor
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes No X
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes X No
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

# 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

### Matters for a solicitor or licensed conveyancer

Alterations have been undertaken to create the existing layout, however it is likely the property has been in its existing layout for some considerable time.

The vendor should be asked to confirm that there are no planned or outstanding repair schemes for the building containing the flat. The flat may have a common building reinstatement policy.

The subjects form part of a block of flats and it has been assumed that maintenance/repair costs of the common parts of the building will be shared on an equitable basis with adjoining proprietors. It is therefore assumed that the cost of common repairs detailed within the report will be apportioned accordingly although exact liability should be confirmed.

The property is a located in a conservation area and as such the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Environment Scotland.

### Estimated reinstatement cost for insurance purposes

TWO HUNDRED AND EIGHTY THOUSAND POUNDS (£280,000).

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

For Listed buildings and historic properties within Conservation Areas you should seek further specialist insurance advice.

### Valuation and market comments

NINETY THOUSAND POUNDS (£90,000).

MARKET COMMENTS:- Prevailing market conditions are reflected in the reported opinion of value

Signed	Security Print Code [576524 = 6409 ] Electronically signed
Report author	Gordon McCulloch
Company name	DM Hall LLP
Address	Suite 2C 1 Pitt Terrace, Stirling, Stirlingshire, FK8 2EZ

Date of report	19th April 2024

# Mortgage Valuation Report



Property Address		
Address Seller's Name Date of Inspection	FLAT, 1A GROUND FLOOR RIGHT THE GLEBE, MAIN STREET, ST NINIANS, STIRLING, FK7 9AN Mr Gordon Wilson 22nd March 2024	
<b>Property Details</b>		
Property Type	House       Bungalow       Chalet       Purpose built maisonette         Coach       Studio       Converted maisonette       X Purpose built flat         Converted flat       Tenement flat       Flat over non-residential use       Other (specify in General Remarks)	
Property Style	□ Detached       □ Semi detached       □ Mid terrace       □ End terrace         □ Back to back       □ High rise block       ▼ Low rise block       □ Other (specify in General Remarks)	
Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police?		
Flats/Maisonettes on	No. of units in block 6	
Approximate Year of	Construction 1875	
Tenure		
X Absolute Ownership	Leasehold Ground rent £ Unexpired years	
Accommodation		
Number of Rooms	1 Living room(s) 1 Bedroom(s) 1 Kitchen(s) 1 Bathroom(s) 0 WC(s) 0 Other (Specify in General remarks)	
Gross Floor Area (ex	cluding garages and outbuildings) 57 m² (Internal) m² (External)	
Residential Element (	(greater than 40%) X Yes No	
Garage / Parking /	Outbuildings	
Single garage Available on site?	□ Double garage       □ Parking space         □ Yes       □ No             X No garage / garage space / parking space	
Permanent outbuildings:		
None of any signific	ant value.	

### Mortgage Valuation Report

Construction									
Walls	Brick	X Stone Cavity		Concrete Steel frame		r frame ete block	Oth	ner (specify in Ge	neral Remarks)
Roof	Tile Lead	X Slate		Asphalt Artificial slate	Felt	ass fibre	Oth	ner (specify in Ge	neral Remarks)
Special Risks									
Has the property s	suffered struct	ural movem	ent?					X Yes	No
If Yes, is this rece	nt or progress	ve?						Yes	X No
Is there evidence, immediate vicinity		son to antic	cipate sub	sidence, h	eave, la	ndslip (	or flood in th	ne Yes	X No
If Yes to any of the	e above, provi	de details in	General	Remarks.					
Service Connec	tion								
Based on visual in of the supply in Ge			ces appe	ar to be no	n-mains	s, pleas	e comment	on the type a	nd location
Drainage	X Mains	Private	None		٧	Vater	X Mains	Private	None
Electricity	X Mains	Private	None		C	Sas	X Mains	Private	None
Central Heating	X Yes	Partial	None						
Brief description o	f Central Heat	ing:							
Gas fired central	heating.								
Site									
Apparent legal iss	ues to be verif	ied by the c	onveyand	cer. Please	provide	a brief	description	n in General R	emarks.
Rights of way	Shared drive	es / access	Garag	e or other am	enities on	separate	e site Sh	ared service con	nections
Agricultural land in	cluded with prope	rty	III-defi	ned boundarie	es		Ot	her (specify in Ge	eneral Remarks)
Location									
Residential suburb	Resi	dential within t	own / city	X Mixed re	esidential	/ comme	rcial Ma	ainly commercial	
Commuter village	Rem	ote village		Isolated	l rural prop	perty	Ot	her (specify in Ge	eneral Remarks)
Planning Issues	;								
Has the property b	een extended	/ converted	d / altered	? X Yes	s No				
If Yes provide deta	ails in General	Remarks.							
Roads									
X Made up road	Unmade road	Partly	/ completed	new road	Ped	destrian a	access only	X Adopted	Unadopted

#### Mortgage Valuation Report

#### **General Remarks**

The property is contained within a principally residential area on one of the main thoroughfares leading towards the town centre of Stirling. A local parade of shops, etc are also located close by. Local amenities are generally all close at hand.

At the time of inspection the subjects were found to have been maintained in an order consistent with age and type, but will require regular and ongoing maintenance particularly to the external building fabric.

The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

Alterations have been undertaken to create the existing layout, however it is likely the property has been in its existing layout for some considerable time.

The vendor should be asked to confirm that there are no planned or outstanding repair schemes for the building containing the flat. The flat may have a common building reinstatement policy.

The subjects form part of a block of flats and it has been assumed that maintenance/repair costs of the common parts of the building will be shared on an equitable basis with adjoining proprietors. It is therefore assumed that the cost of common repairs detailed within the report will be apportioned accordingly although exact liability should be confirmed.

The property is a located in a conservation area and as such the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Environment Scotland.

Essential Repairs				
No essential repairs required for mortgage purp	poses.			
Estimated cost of essential repairs £	Retention recommended? \( \square\) vos	X No.	Amount f	_
Estimated cost of essential repairs £	Retention recommended? Yes	X No	Amount £	

### Mortgage Valuation Report

Comment on Mortgagea	bility	
The subjects form suitable	e security for mortgage purposes.	
Valuations		
Market value in present con Market value on completion Insurance reinstatement va (to include the cost of total is a reinspection necessary	n of essential repairs lue rebuilding, site clearance, professional fees, ancillary charges plus VAT)	£ 90,000 £ 280,000
What is the reasonable rangmonth Short Assured Tenar	ge of monthly rental income for the property assuming a letting on a 6	£
	here there is a steady demand for rented accommodation of this type?	Yes No
Declaration		
Signed	Security Print Code [576524 = 6409 ] Electronically signed by:-	
Surveyor's name	Gordon McCulloch	
Professional qualifications	MRICS	
Company name	DM Hall LLP	
Address	Suite 2C 1 Pitt Terrace, Stirling, Stirlingshire, FK8 2EZ	
Telephone Fax	01786 475785 01786 450406	
Report date	19th April 2024	

# PROPERTY QUESTIONNAIRE





Property address	FLAT, 1A GROUND FLOOR RIGHT THE GLEBE, MAIN STREET, ST NINIANS, STIRLING, SCOTLAND, FK7 9AN
Seller(s)	Gordon Wilson
Completion date of property questionnaire	17.04.2024

#### **Note for sellers**

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer
  each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell
  your solicitor or estate agent immediately.

#### Information to be given to prospective buyer(s)

1.	Length of ownership
	How long have you owned the property? 15 Years
2.	Council tax
	Which Council Tax band is your property in? (Please circle)
	A B C D E F G H
3.	Parking
	What are the arrangements for parking at your property?
	(Please tick all that apply)
	Garage
	Allocated parking space
	• Driveway
	Shared parking
	● On street
	Resident permit
	Metered parking
	Other (please specify):
4.	Conservation area
	Is your property in a designated Conservation Area (i.e. an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?  Yes / No / Don't know desirable to preserve or enhance)?

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	<del>Yes</del> / No
6.	Alterations/additions/extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?  If you have answered yes, please describe below the changes which you have made:	<del>Yes</del> / No
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?  If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.  If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	<del>Yes</del> / <del>Ne</del>
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property?  If you have answered yes, please answer the three questions below:	<del>Yes</del> / No
	(i) Were the replacements the same shape and type as the ones you replaced?	<del>Yes</del> / <del>No</del>
	(ii) Did this work involve any changes to the window or door openings?	<del>Yes</del> / <del>No</del>
	(iii) Please describe the changes made to the windows, doors or patio doors (vidates when the work was completed):	vith approximate
	Please give any guarantees which you received for this work to your solicitor or e	estate agent.

7.	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	Yes / <del>Ne</del> / <del>Partial</del>
	If you have answered yes / partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).	
	Gas-fired	
	If you have answered yes, please answer the three questions below:	
b.	When was your central heating system or partial central heating system installed?	Cannot answer
C.	Do you have a maintenance contract for the central heating system?	<del>Yes</del> / No
	If you have answered yes, please give details of the company with which you have a maintenance contract:	
d.	When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes / <del>No</del>
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	<del>Yos</del> / No
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	<del>Yos</del> / <del>No</del>
b.	Are you aware of the existence of asbestos in your property?	<del>Yes</del> / No
	If you have answered yes, please give details:	

10.	Services					
a.	Please tick which services are connected to your property and give details of the supplier:					
		Services	Connected	Supplier		
		Gas / liquid petroleum gas	✓	Not known		
		Water mains / private water supply	✓	Not Known		
		Electricity	✓	Not known		
		Mains drainage	✓	Not Known		
		Telephone				
		Cable TV / satellite				
		Broadband				
b.		e a septic tank system at your ave answered yes, please		estions below:	<del>Yos</del> / No	
C.	(i) Do y	ou have appropriate conse	nts for the discha	rge from your septic tank?	Yes / Ne / Den't knew	
d.	(ii) Do y	ou have a maintenance co	ntract for your sep	otic tank?	Yes / No	
	If you I have a	nave answered yes, please maintenance contract:	give details of the	ne company with which you		

11.	Responsibilities for Shared or Common Areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?	<del>Yes</del> / No / <del>Den't Knew</del>
	If you have answered yes, please give details:	
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?	<del>Yes</del> / No / <del>Not applicable</del>
	If you have answered yes, please give details:	
C.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	<del>Yes</del> / No
d.	Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?	<del>Yos</del> / No
	If you have answered yes, please give details:	
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?	<del>Yes</del> / No
	If you have answered yes, please give details:	
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)	<del>Yes</del> / No
	If you have answered yes, please give details:	
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property?	<del>Yes</del> / No
	If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	

	1	
b.	Is there a common buildings insurance policy?	<del>Yes</del> / No / <del>Den't Knew</del>
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	Yes / No / Den't Knew
C.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	Yes / <del>Ne</del>
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:	
	Rising damp in bedroom and kitchen with repairs instructed by me in December 2016 after I became the owner of the property	
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	Yes / Ne
	If you have answered yes, please give details:	
	Damp proof course installed	
C.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	Yes / Ne
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.	
	Guarantees are held by:	

14.	Guarantees						
a.	Are there any guarantees or warranties for any of the following:						
(i)	Electrical work	No	Yos	Don't know	With title doods	Lost	Cannot Answer*
(ii)	Roofing	No	Yes	Don't know	With title doods	Lost	Cannot Answer*
(iii)	Central heating	No	Yos	Don't know	With title deeds	Lost	Cannot Answor*
(iv)	NHBC	No	Yos	Don't know	With title doods	Lost	Cannot Answer*
(v)	Damp course	Ne	Yes	Don't know	With title doods	Lost	Cannot Answor*
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No	Yes	Don't know	With title doods	Lost	Cannot Answor*
b.	If you have answered 'yes' or 'with title deed or installations to which the guarantee(s) rela	ls', pleas te(s):	e give de	etails of t	he work		
	Damp proofing installed and rising damp in 2016	with 20 y	ear guara	intee.			
C.	Are there any outstanding claims under any o	of the gua	arantees	listed abo	ve?	<del>Yes</del> / No	
	If you have answered yes, please give details:						
15.	Boundaries						
	So far as you are aware, has any boundary of your property been moved in the last 10 years?  If you have answered yes, please give details:					<del>Yes</del> / No / <del>Don't know</del>	

16.	Notices that affect your property	
	In the past 3 years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	Yes / No / Den't know
b.	that affects your property in some other way?	<del>Yes</del> / No / <del>Don't know</del>
C.	that requires you to do any maintenance, repairs or improvements to your property?	<del>Yes</del> / No / <del>Den't knew</del>
	If you have answered yes to any of a-c above, please give the notices to your so agent, including any notices which arrive at any time before the date of entry of t your property.	olicitor or estate he purchaser of

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s):			
·			
Date:			



#### **ABERDEEN**

aberdeen\_residential@dmhall.co.uk01224 594172

#### **AYR**

ayr@dmhall.co.uk 01292 286974

#### **DUMFRIES**

dumfries@dmhall.co.uk 01387 254318

#### **DUNDEE**

dundee@dmhall.co.uk 01382 873100

#### **DUNFERMLINE**

dunfermline@dmhall.co.uk 01383 621262

#### **EDINBURGH**

edinburghresidential@dmhall.co.uk 0131 624 6600

#### **FLGIN**

elgin@dmhall.co.uk 01343 548501

#### **FALKIRK**

falkirk@dmhall.co.uk 01324 628321

#### **GALASHIELS**

galashiels@dmhall.co.uk 01896 752009

#### **GLASGOW** (Residential)

glasgowresidential@dmhall.co.uk 0141 636 4141

#### **HAMILTON**

hamilton@dmhall.co.uk 01698 284939

#### **INVERNESS**

inverness@dmhall.co.uk 01463 241077

#### **INVERURIE**

inverurie@dmhall.co.uk 01467 624393

#### **IRVINE**

irvine@dmhall.co.uk 01294 311070

#### **KIRKCALDY**

kirkcaldy@dmhall.co.uk 01592 598200

#### LIVINGSTON

livingston@dmhall.co.uk 01506 490404

#### **OBAN**

oban-admin@dmhall. co.uk 01631 564225

#### **PAISLEY**

Enquiries are now dealt with at our Glasgow Hub.

#### **PERTH**

perth@dmhall.co.uk 01738 562100

#### **PETERHEAD**

peterhead@dmhall.co.uk 01779 470220

#### **ST ANDREWS**

standrews@dmhall.co.uk 01334 844826

#### **STIRLING**

stirling@dmhall.co.uk 01786 475785

